

TREE #	ADDRESS (W. Green St.)	INVENTORY SITE NUMBER	ID #	Tree Species	REASON FOR REMOVAL	MIKE BRUNK'S NOTES	KEVIN/ DAVEY INVENTORY NOTES	ADDITIONAL NOTES	2013 HAZARD RATING	UPDATED HAZARD RATING
1	802	#2	13605	Sugar Maple	Tree condition and Bus Stop/ADA (within footprint of bus stop)	(no comments)	Cabled system installed, potential of failure evident	Bad crotch south side with included bark, potential failure, weeping. Very soft root flare south side, hollow sounded with hammer	6	7
2	802	#1	722	Sugar Maple	Tree condition and Bus Stop/ADA (within footprint of bus stop)	Bad shape/declining tree	Location , poor condition (2013), continued maintenance issues	Major decline, trunk completely hollow, very limited holding wood. Failure high risk Deadwood pruned 8/18/14	6	8
3	712	#1	4116	Siberian Elm (non native)	Species and tree condition; removing marginal tree in favor of better species on private property	Bad tree	Fair condition (2013); species (Elm) susceptible to disease (wetwood) and ice storm	Elm is ice storm/wind storm susceptible, major lean over street, encroaching on resident nice Buckeye (better species)	6	6
4	702	#1	17611	Sugar Maple	Tree condition	Declining tree	Location , poor condition (2013), continued deadwood issue	Fruiting bodies at root flare, failure waiting. Major trunk damage, trunk sounds hollow with sounding hammer Deadwood prune 1/26/15	6	7
5	609	#1	352	Sugar Maple	Tree condition (tree close to sidewalk; minimum 10-inch excavation to replace sidewalk)	Declining tree/fungus up top	Fair condition (2013), poor structure	Bad trunk, wound/cavity east side	6	7
6	601	#1	10521	Red Maple	Tree condition and Bus Stop/ADA; trade-off to save other tree (sidewalk will be at same elevation as bus pad with roughly 2-foot excavation in total for sidewalk excavation and change in elevation)	Can sidewalk be sawed so tree isn't impacted?	Location , fair condition (2013)	Root system will take major damage thru construction	6	6
7	508/502	#3	4956	Red Maple	Tree condition (root system exposed; minimum 10-inch excavation to replace sidewalk)	Tree not in good shape	(no comments)	Dieback in canopy, cavity in center lead from loss of top, poor structure Deadwood pruned 8/1/14		6
8	503	#1	5180	Sugar Maple	Tree condition (right on sidewalk; minimum 10-inch excavation to replace sidewalk)	Remove declining tree/ Dead at Top	Fair condition (2013)	Should be listed as poor condition, cavity at root flare, hazard	6	8
9	501	#1 SA	5922	Sugar Maple	Tree condition and grading/ADA; proximity to sidewalk (minimum 2-foot excavation for sloping ADA ramp and sidewalk excavation)	Tree has Bees in it. Try to save Sugar Maple. Ramps could be a concern.	(no comments)	Honey Bee in hollow 15' east side, trunk hollow sounding hammer. Poor location to existing sidewalk	6	6